




**PRODUCT SPOTLIGHT**  
This bulletin contains valuable product related information.  
**NOVEDADES DEL PRODUCTO**  
Este boletín contiene información valiosa relacionada a este producto.  
**ACCENT PRODUIT**  
Ce bulletin contient de l'information utile sur les produits.



## Ford 6.0L Diesel 167582 Solid Flywheel Availability.

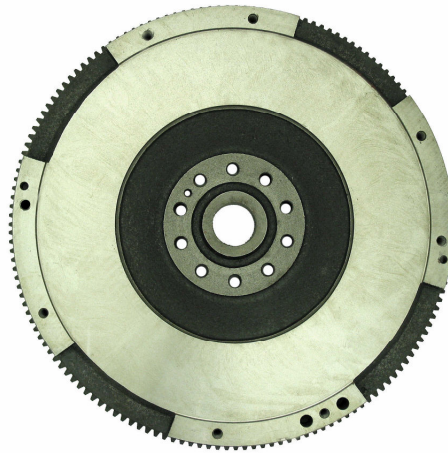

AMS offers a solid flywheel retrofit part number 167582 that replaces the dual-mass flywheel (DMF) originally utilized in 2003-04 Ford trucks equipped with a 6.0L diesel engine.

Ford discontinued the Dual Mass Flywheel (DMF) in the mid 2004 model year and is replacing all 2003-04 6.0L DMF applications with a solid flywheel system in OE service. Replacement DMF's and corresponding clutch kits, therefore, are not readily available. Our 167582 solid flywheel and matching clutch kit parallels the Ford re-design. Ford 2003-04 6.0L light trucks equipped with the DMF can now be easily retrofitted to a solid flywheel system.

**Attention:** The replacement 167582 flywheel is supplied with flywheel mounting bolts. Shorter flywheels to crankshaft mounting bolts are required for this conversion. Although many 2003-04 vehicles have been converted to a solid flywheel, we strongly recommend that the OEM solid flywheel bolts coming off the vehicle are not re-used. Always use the new crankshaft to flywheel bolts supplied with the 167582 flywheel when servicing these vehicles.

**For additional information, please contact our technical service department at 800.528.6743**